

~~RESTRICTED~~

COPY NO.

RM No. E8F29

UNCLASSIFIED

~~NACA~~

copy 1

RESEARCH MEMORANDUM

OPERATING TEMPERATURES OF I-40-5 TURBOJET ENGINE
BURNER LINERS AND THE EFFECT OF TEMPERATURE
VARIATION ON BURNER-LINER SERVICE LIFE

By H. D. Wilsted, Robert T. Duffy
and Ralph E. Grey

Flight Propulsion Research Laboratory

Cleveland, Ohio

CLASSIFICATION CANCELLED

Authority

J. W. Crowley
EO 12501

Date 12/14/53

1

JH-1-1954
RF 1953

See

CLASSIFIED DOCUMENT
This document contains classified information affecting the National Defense of the United States within the meaning of the Espionage Act, USC 50:31 and 32. Its transmission or the revelation of its contents in any manner to an unauthorized person is prohibited by law. Information so classified may be imparted only to persons in the military and naval services of the United States, appropriate civilian officers and employees of the Federal Government who have a legitimate interest therein, and to United States citizens of known loyalty and discretion who of necessity must be informed thereof.

TECHNICAL
EDITING
WAIVED

NATIONAL ADVISORY COMMITTEE
FOR AERONAUTICS

WASHINGTON
August 23, 1948

~~RESTRICTED~~
UNCLASSIFIED



3 1176 01435 5433

NACA RM No. E8F29

~~RESTRICTED~~

UNCLASSIFIED

NATIONAL ADVISORY COMMITTEE FOR AERONAUTICS

RESEARCH MEMORANDUM

OPERATING TEMPERATURES OF I-40-5 TURBOJET ENGINE

BURNER LINERS AND THE EFFECT OF TEMPERATURE

VARIATION ON BURNER-LINER SERVICE LIFE

By H. D. Wilsted, Robert T. Duffy
and Ralph E. Grey

SUMMARY

Investigations of burner liners were conducted in a 4000-pound-thrust turbojet engine to determine, if possible, the principal factors **limiting the burner-liner service life**. The investigations covered a range of engine speeds from 3500 to 11,500 rpm. Chromel-alumel thermocouples were welded to the burner liner and tests were run to determine whether bare, **ceramic-coated**, or shielded thermocouples would give the most nearly correct temperature **readings**.

The ceramic-coated thermocouple was found to be least affected by cool **combustion** air flowing over the leads and was used throughout the runs. **Burner-liner temperatures were found to rise at an increasing rate with engine speed and to have the same characteristics as the indicated burner-exit gas temperature**. The **maximum indicated burner-liner temperature and the maximum indicated burner-exit gas temperature** recorded were 1590° and 1690° F, respectively. The liner **circumferential** temperature, besides varying greatly from point to point, was definitely highest at the bottom section as installed in the burner. **Temperature gradients as great as 700° F per inch were measured in the liner**. It is believed that the high local temperature gradients in the liner are the cause of the short service life.

INTRODUCTION

One of the factors that limit the use of the gas-turbine engine by the **armed** forces and in commercial **transport** service is its very short service life as **compared** with the **reciprocating** engine. The burner liners, which are **directly exposed** to the gases undergoing

~~RESTRICTED~~

UNCLASSIFIED

combustion, are subject to high thermal loads, intensive thermal shock during engine starting and accelerating, and the corrosive action of the combustibles. These factors result in a short burner-liner service life and, in **turn, reduce** the service life of many turbojet engines so that frequent inspection and replacement of **liners** are required.

As part of the program to improve the service life of the **gas-turbine** engine, a study of improved **materials and** improved cooling of engine critical parts has been undertaken at the NACA Cleveland laboratory. The operating temperatures and temperature distribution of the burner liners were obtained from an I-40-5 turbojet engine.

APPARATUS

The I-40-5 turbojet engine used in this investigation was equipped with a **19-inch-diameter jet** nozzle. A sketch of an **I-40** engine showing a burner-liner installation is presented in figure 1 and a photograph of a burner liner before thermocouples were attached for testing is shown in figure 2. The liner material for the two liners investigated was **0.031-inch Inconel** sheet. Each liner was investigated separately in burner **12**. (See fig. 1.)

All burner-liner temperatures were measured by **chromel-alumel** thermocouples spot-welded to the **burner liners** and coated with ceramic cement, as shown in figure 3(b). The test runs were made using a different thermocouple arrangement on each of the two burner liners. The **bayonet-type** thermocouple used to indicate burner-exit gas temperatures is shown in figure 4. A **chronometric** tachometer was **used** to measure engine speed.

PROCEDURE AND RESULTS

Tests were run with three different methods of mounting **thermo-**couples on the burner liner to determine the effect of the comparatively **cool** combustion air passing over the thermocouple: bare, ceramic-coated, and -shielded (fig. 3). The data presented in figure 5 show that the **ceramic-coated** thermocouple is least **affected**, the **bare** thermocouple only slightly more affected, and the shielded thermocouple most affected **by the** cool-air flow over the thermocouples. Apparently care must be taken to keep small the area of the liner **covered by** the ceramic in order that normal cooling of the burner liner adjacent to the thermocouple be maintained. At **the time** of application, the significance of the amount of ceramic

coating used was not fully realized and some variation in **temperature** readings probably occurred **because** varying amounts, of ceramic coating were used.

As a further check on the correctness of **temperature** measurement, ceramic-coated thermocouples were placed on the outer and inner surfaces of the burner liner at the same position, as indicated by thermocouples 6 and 7, 8 and 9, 26 and 27 (fig. 6). One thermocouple of each pair was then exposed to the hot combustion gases and the other to the cooler **entering combustion** air. **The maximum** variation **was** found to be 85° F between any pair of thermocouples. This variation is less than 7 percent or a probable **error** due to cooling of the outside ceramic-coated thermocouple leads of less than 3.5 percent.

The thermocouple locations **on** the first burner liner investigated (**designated** liner A) are shown in figure 6. The results of the investigations of liner A over a complete range of engine **speed** are shown in figures 7, 8, and 9. Figure 7 **shows the temperature** variation along the top row of cooling louvers. **At maximum engine** speed a variation of the order of 600° F in a length of 3 inches is shown. The **maximum** indicated temperature along the row of louvers **is** of the order of 1300° F.

The temperature variation **along** the center line of a section **containing** air-intake holes is shown **in** figure 8. This section is on the bottom of the liner, as shown in **figure** 6. With one exception, **the maximum indicated temperature was** only of the order of 1000° F if the noncritical **liner-exit** section is not considered. As can be seen from figure 9, **these values** are probably **peculiar to** the particular section and no general **conclusions comparing** the louver and air-intake sections can be drawn. The wide circumferential temperature variations shown **in figure** 9 indicate **no** definite trend. An irregularity exists, however, in the pattern with the highest temperature region located at the lowest portion of the burner liner **as installed in burner 12.**

The thermocouple **locations** on burner **liner** B are shown in figure 10. **In** this case, it was felt that temperatures taken between the row of holes and louvers would be more **indicative** of the effective liner temperature because less variation would result from **cooling** effects of the incoming air.

The thermocouples on burner **liner** B are located **in** circumferential belts; therefore the average **circumferential** temperature for each position along the length of the liner can be plotted as in

figure 11. The average values show the following trend: a peak in temperature about **one-third** the length downstream on the liner with a greater **peak occurring** at the liner exit. It is in the **region** of the first-mentioned peak **temperature** that liners have failed in IVACA investigations. These failures **occur** in the form of fractures and severe warping **extending** from the louvers to the air-intake holes at a section approximately 8 inches from the inlet end of the liner. This failure belt will hereinafter be referred to as the "critical section." Inspection of service **liners** has also shown failures at other locations between air-intake holes and **louvers** but in **every** case of this **type** there was a **more** serious failure at the **critical** section.

A **replot** of the data used in figure 11 is presented for each temperature belt in figure 12 to show the temperature variations with speed. The trend of rising **burner-liner temperature** with increasing speed or power in figure 12 is reasonably uniform. The irregularity of temperature **belt 2** is attributed to the disturbance of the interconnector fittings on air flow. Also shown is the Indicated burner-exit gas temperature, which reached a maximum of **1690° F** at an **engine** speed of **11,500 rpm**. In general, **all** the **curves** are reasonably smooth with temperatures rising at an increasing rate with engine speed.

The circumferential temperature **variation nearest** the critical section is presented in figure 13. An appreciable temperature variation occurs with a decidedly high-temperature **region** located at the lowest portion of the burner liner as installed in burner 12. This **peak agrees with that of figure 9**. The high-temperature **region** is behind the right-hand **interconnector** fitting. The axial **temperature distribution** along this section is shown in figure 14 and the **temperature** behind the left-hand interconnector fitting in figure 15. These figures also show the **maldistribution** indicated in figure 13. The peak temperatures behind the right-hand **interconnector** fitting at the higher speeds are of the order of **500° F** greater than the corresponding section behind the left-hand interconnector fitting. Inasmuch as air-flow patterns approaching the burner have **not** yet been obtained, it is not **known** whether this shift is a result of air-flow variations or maldistribution of fuel.

The temperature variations along the top of burner liner B, between the louvers and **air-intake** holes, are shown in figure 16. Except for the rapid variation in temperature at the section between the **series** of small and large air-intake **holes**, a relatively small **temperature** variation exists as contrasted by the variations in figures 7 and 8 for the axial distribution along the center line of the

sections containing the louvers and air-intake holes, respectively. An examination of the data shows that the highest indicated burner-liner temperature recorded in these investigations was 1590° F, as shown in figure 9 at an engine speed of 11,500 rpm. This peak temperature occurred in the thermocouple belt $9\frac{1}{2}$ inches from the inlet end of the liner near the critical section.

Temperature gradients as great as 700° F per inch of circumference are shown in figure 9 (point A). The high-temperature gradients from point to point in the burner liner are probably the cause of failure, the principal factor at the present time limiting the service life of the gas-turbine engine. Any process or method that will remove heat from the hot spots or give a more even temperature distribution such as the use of heavier gage metal for the liners to more rapidly conduct heat away from the hot spots or the use of cooling fins to remove heat from the high temperature areas should add materially to the burner-liner service life.

A liner failure typical of 14 Liners removed from a service engine after 36 hours and 10 minutes operation is shown in figure 17. The severe warping and fractures are clearly shown in the photograph. The most severe warping and fractures occur in the belt of louvers marked "critical section."

Because of the comparatively short service life as limited by warping and fracturing, liner corrosion is not a problem at the present time.

SUMMARY OF RESULTS

The operating indicated temperatures and temperature distribution obtained over a complete range of engine speeds for two turbo-jet engine burner liners investigated separately in burner 12 of the engine showed that:

1. Temperature variations from point to point on the burner liner were extreme. The measured local temperature gradients were as large as 700° F per inch. The warping and fractures, occurring principally between the louvers and adjoining intake-air holes, are attributed to these extreme temperature gradients.

2. The maximum burner-liner indicated temperature (1590° F) occurred at a point about $9\frac{1}{2}$ inches from the inlet end of the liner.

This thermocouple was one of the belt nearest the critical section, which is located about 8 **inches downstream of** the burner-liner inlet. Most of the buckling and fracturing of burner liners **investigated** occurred in the critical section.

3. Indicated burner-liner temperatures **were** found to rise **at** an increasing rate **with** engine speed, having the same characteristics as the indicated burner-exit gas temperature. **The maximum** indicated burner-liner **and** maximum indicated burner-exit **gas** temperatures were **1590°** and **1690°** F, respectively. The liner circumferential temperature distribution, besides **varying** greatly from point to point, was definitely higher at the bottom section as installed in the burner.

Flight Propulsion Research Laboratory,
National Advisory Committee for Aeronautics,
Cleveland, Ohio.

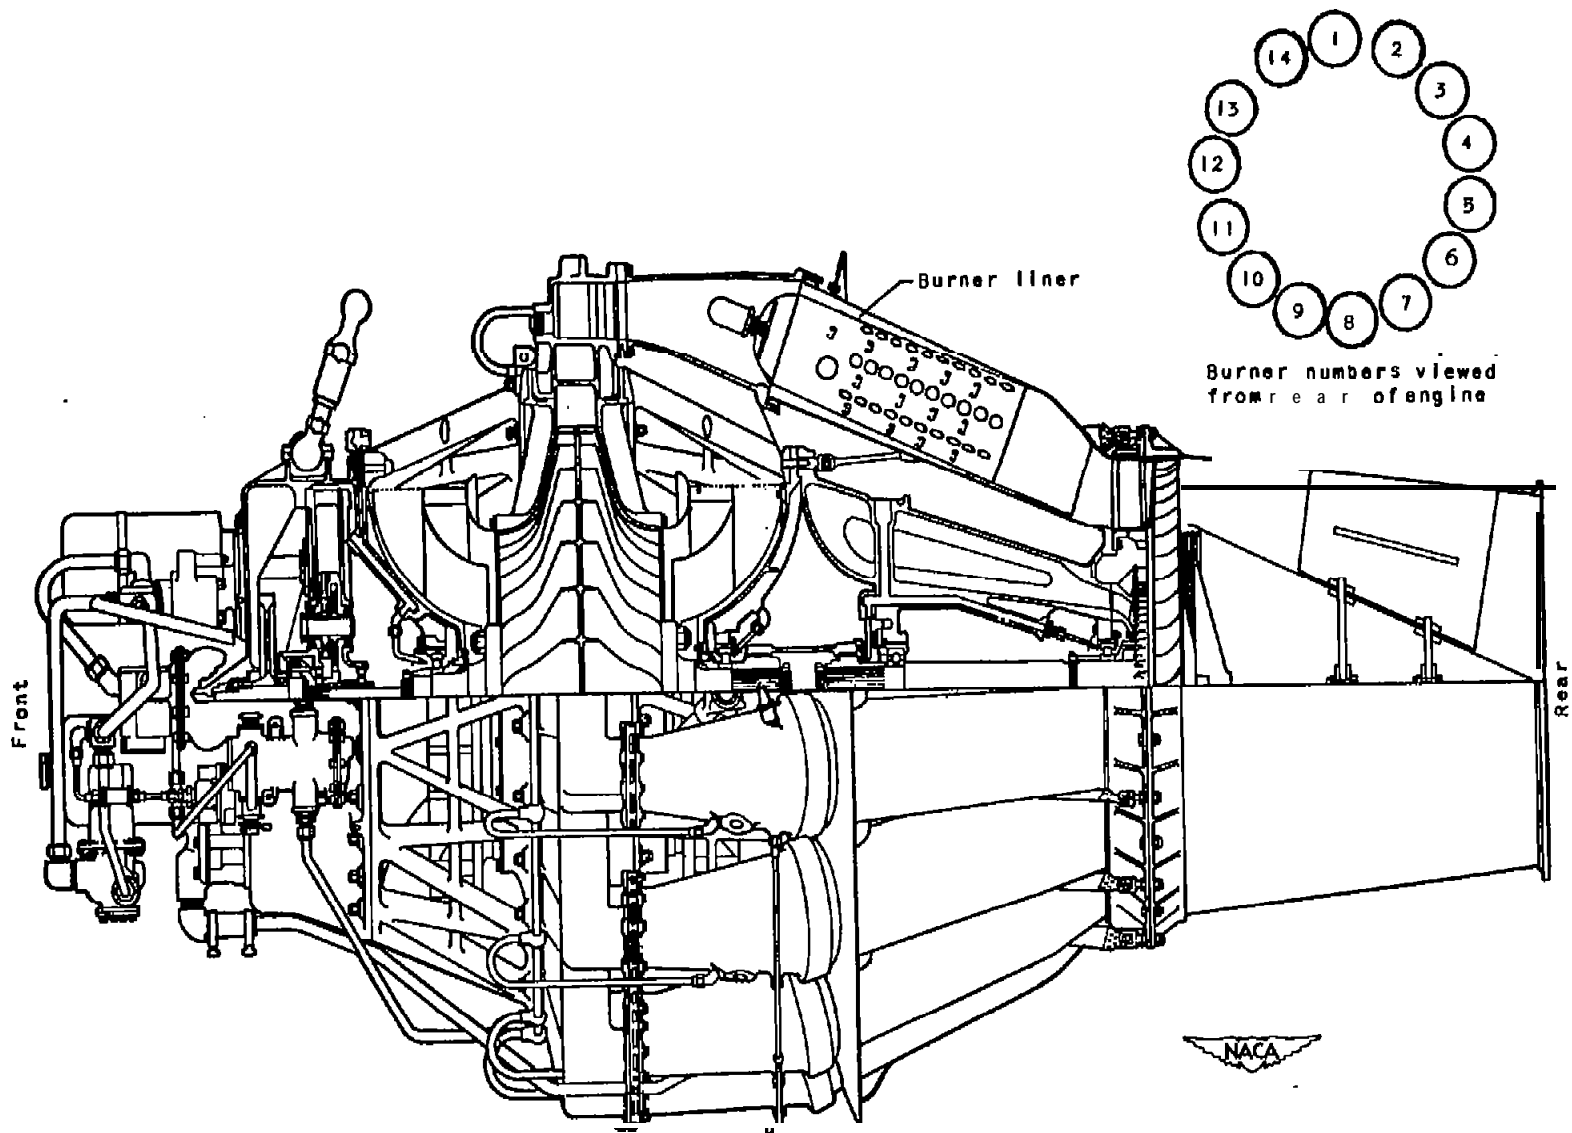


Figure I. - The I-40 turbojet engine showing typical burner-liner installation.

1

2

3

4

5

6

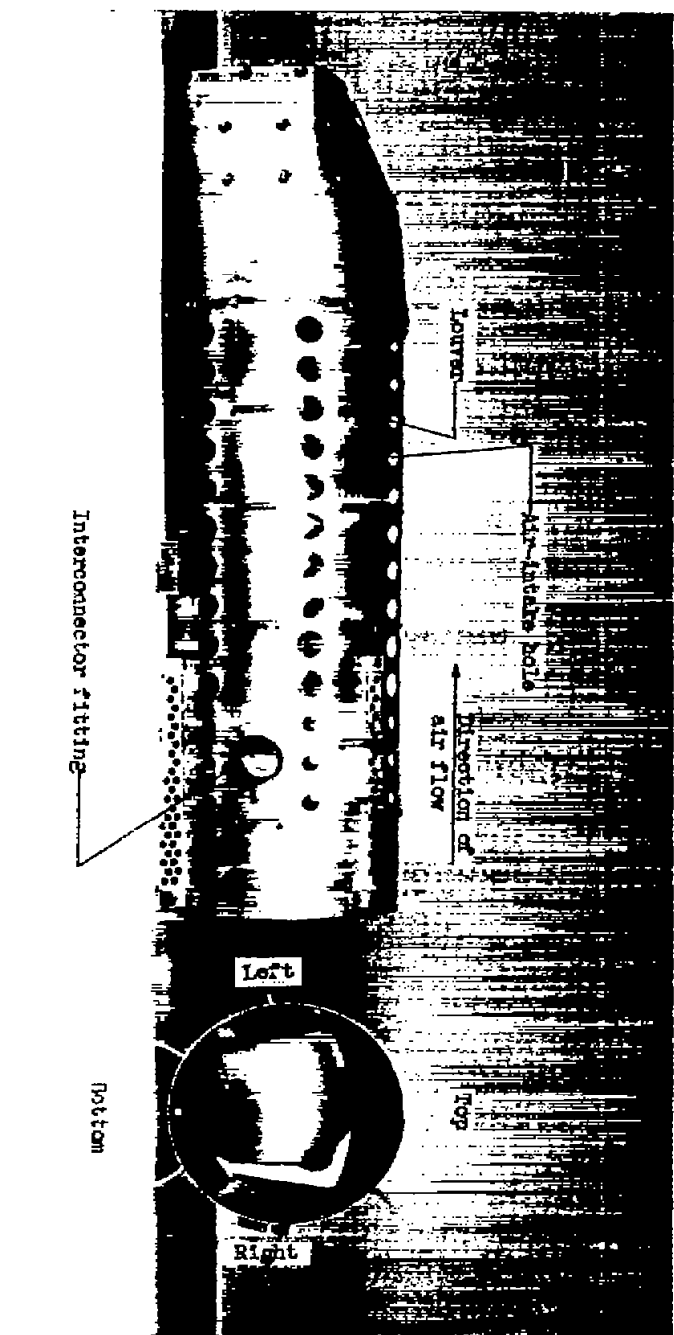


Figure 2. - Turbojet engine burner liner.



C-13153
9-20-45

1

2

3

4

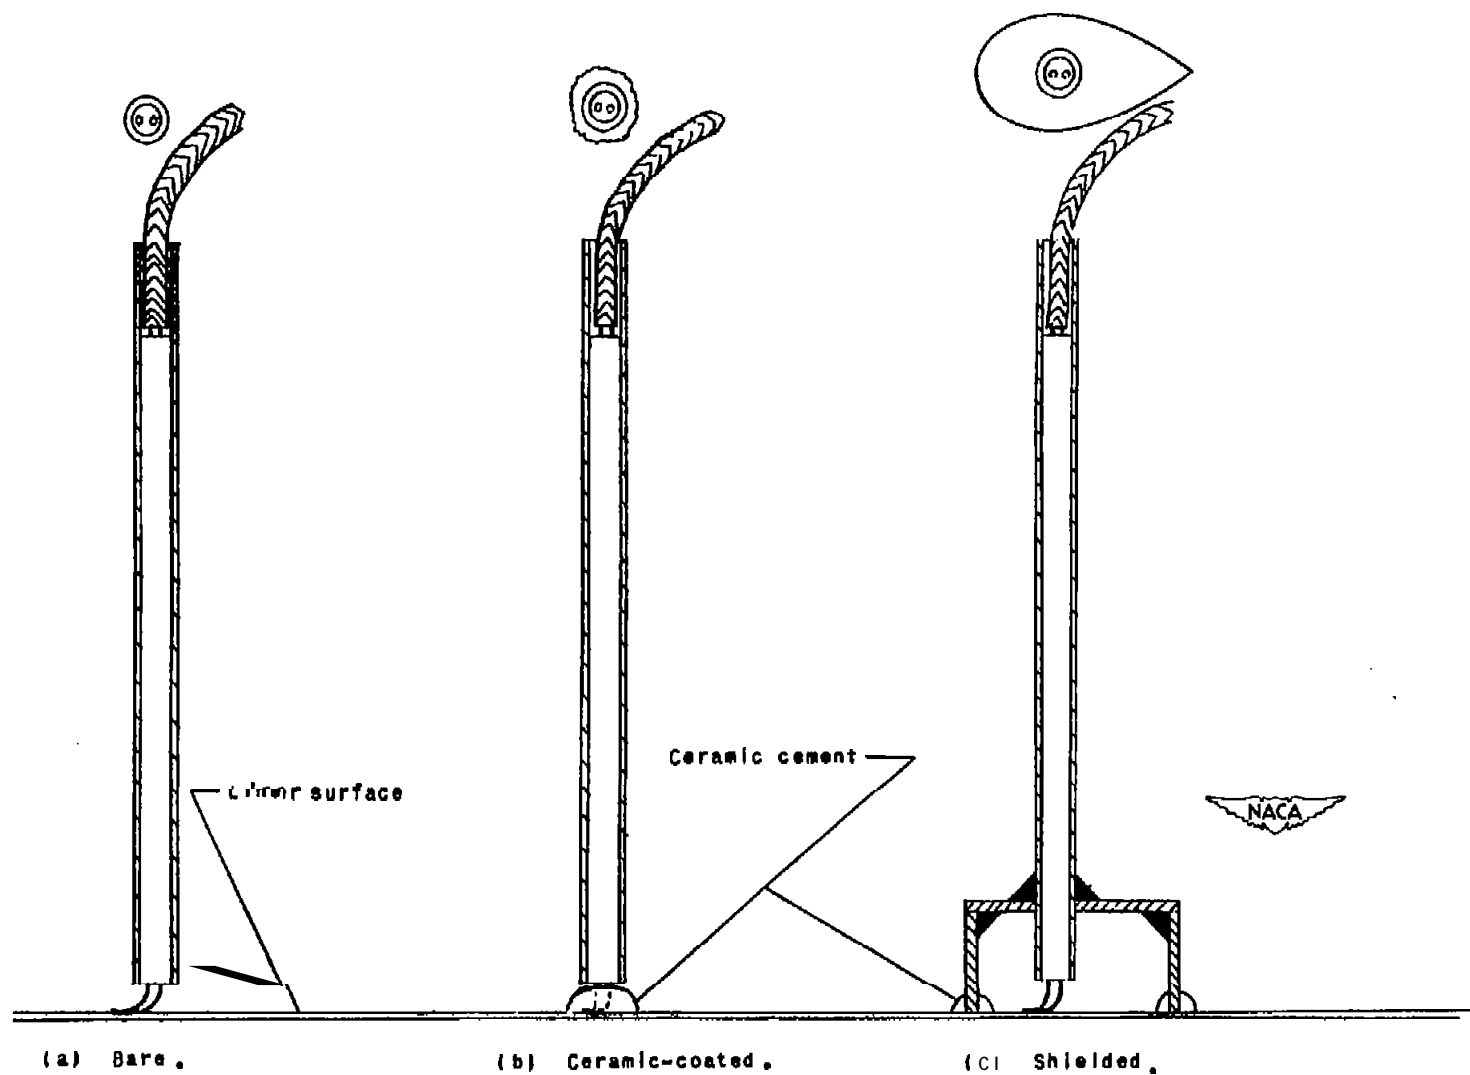


Figure 3. - Thermocouple installations used to determine most correct method of measuring burner-liner temperatures. Thermocouple wires spot-welded to liner.

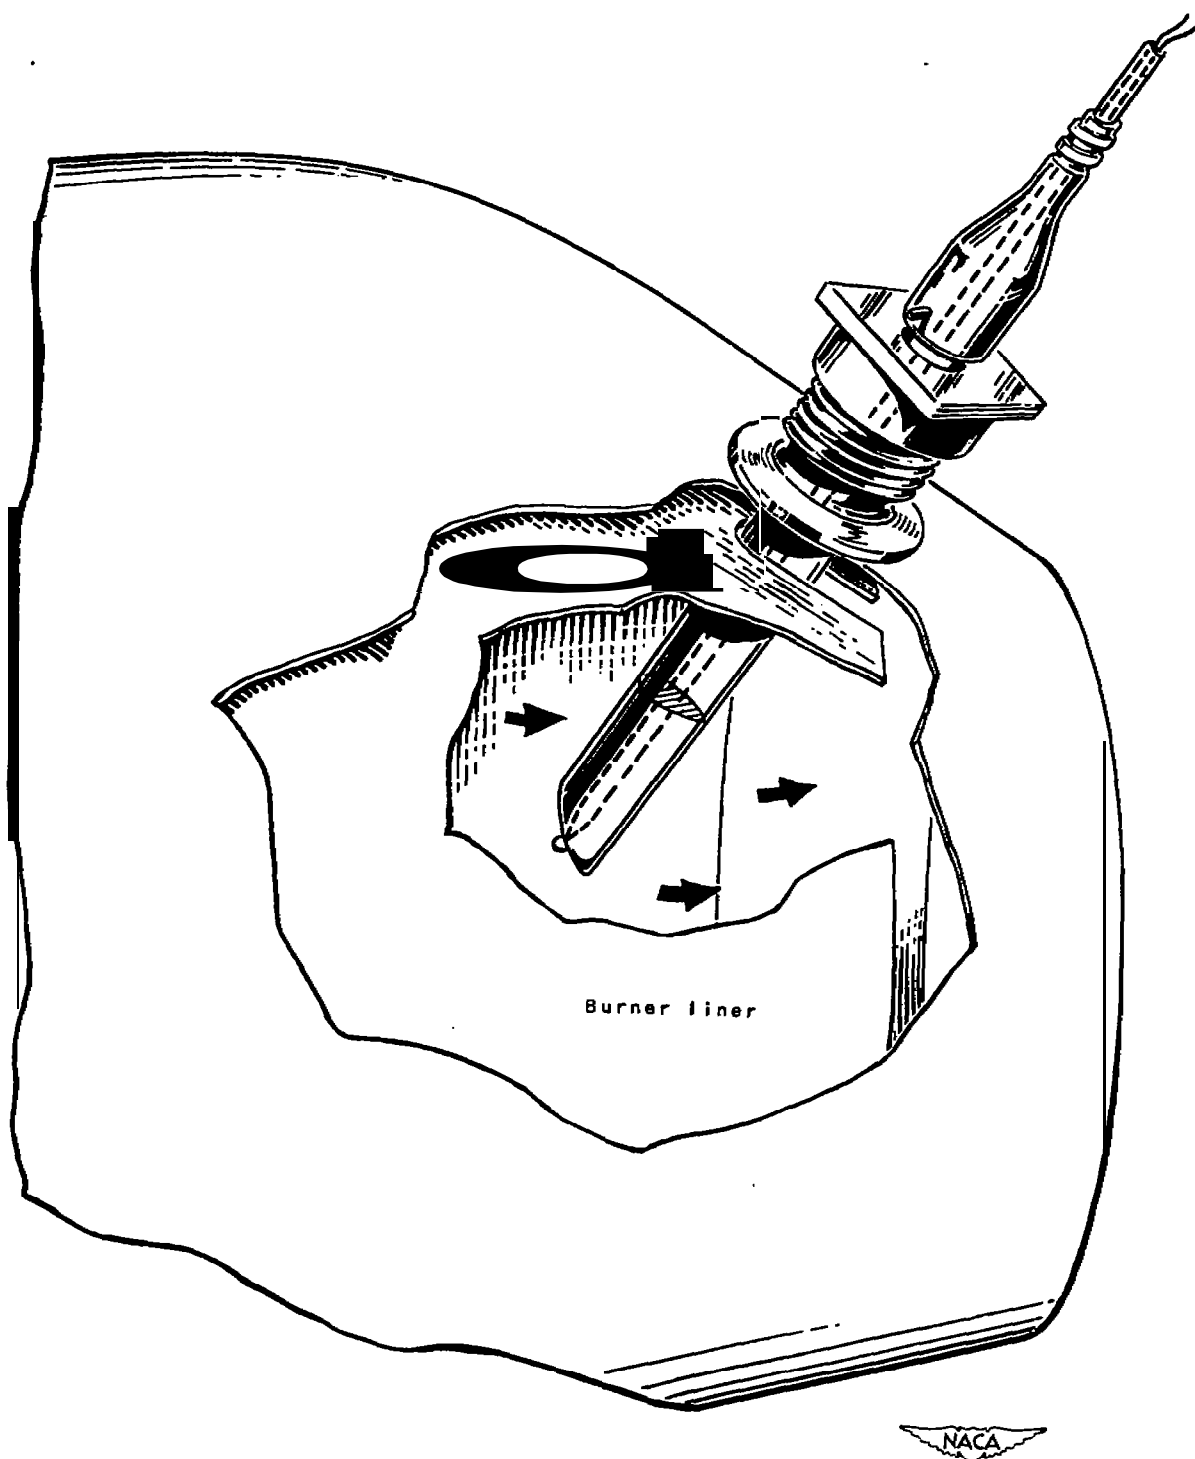


Figure 4. - Bayonet-type thermocouple installed in burner exit to indicate burner-exit gas temperature.

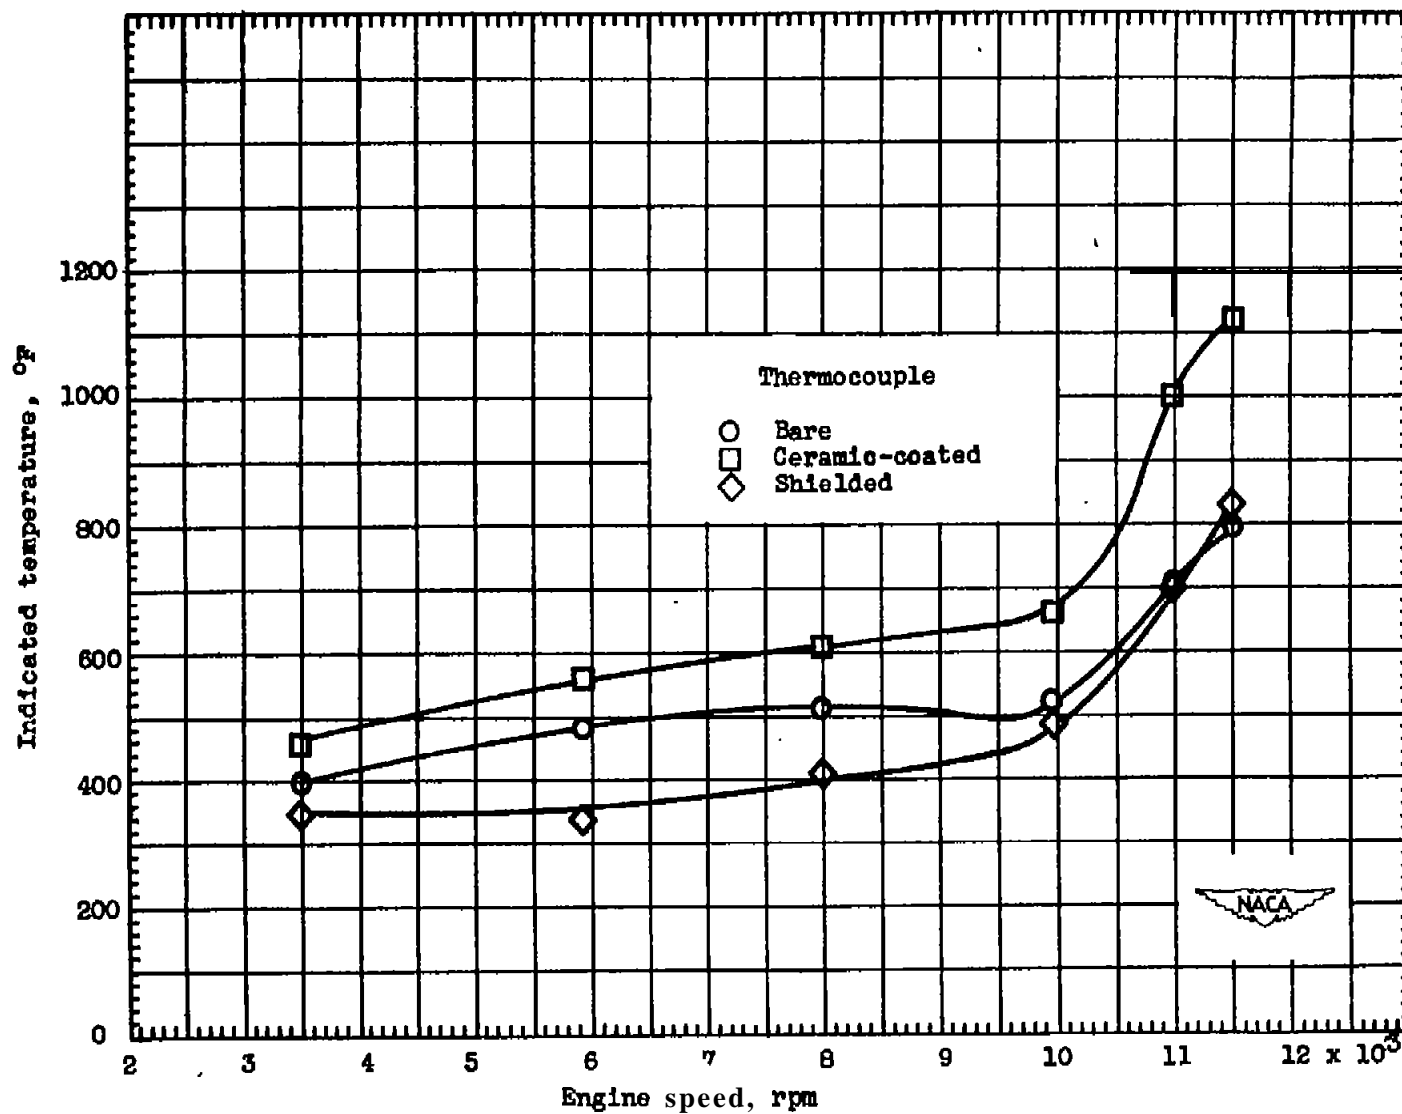


Figure 5 - Comparison of bare, ceramic-coated, and shielded thermocouple readings at various engine speeds,

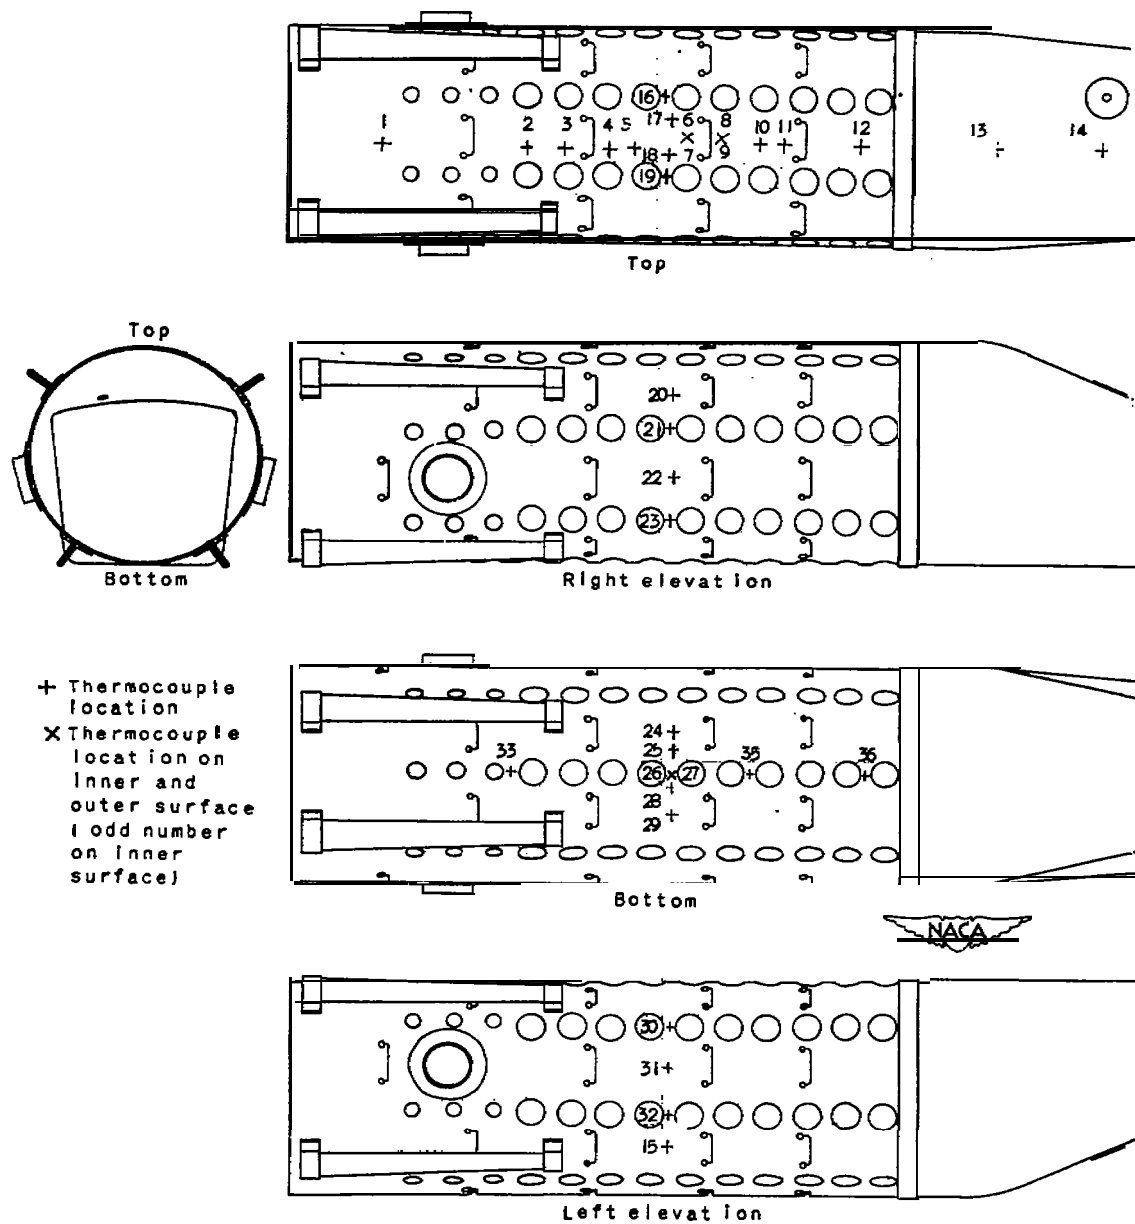


Figure 6. - Thermocouple locations and numbers on burner liner A.

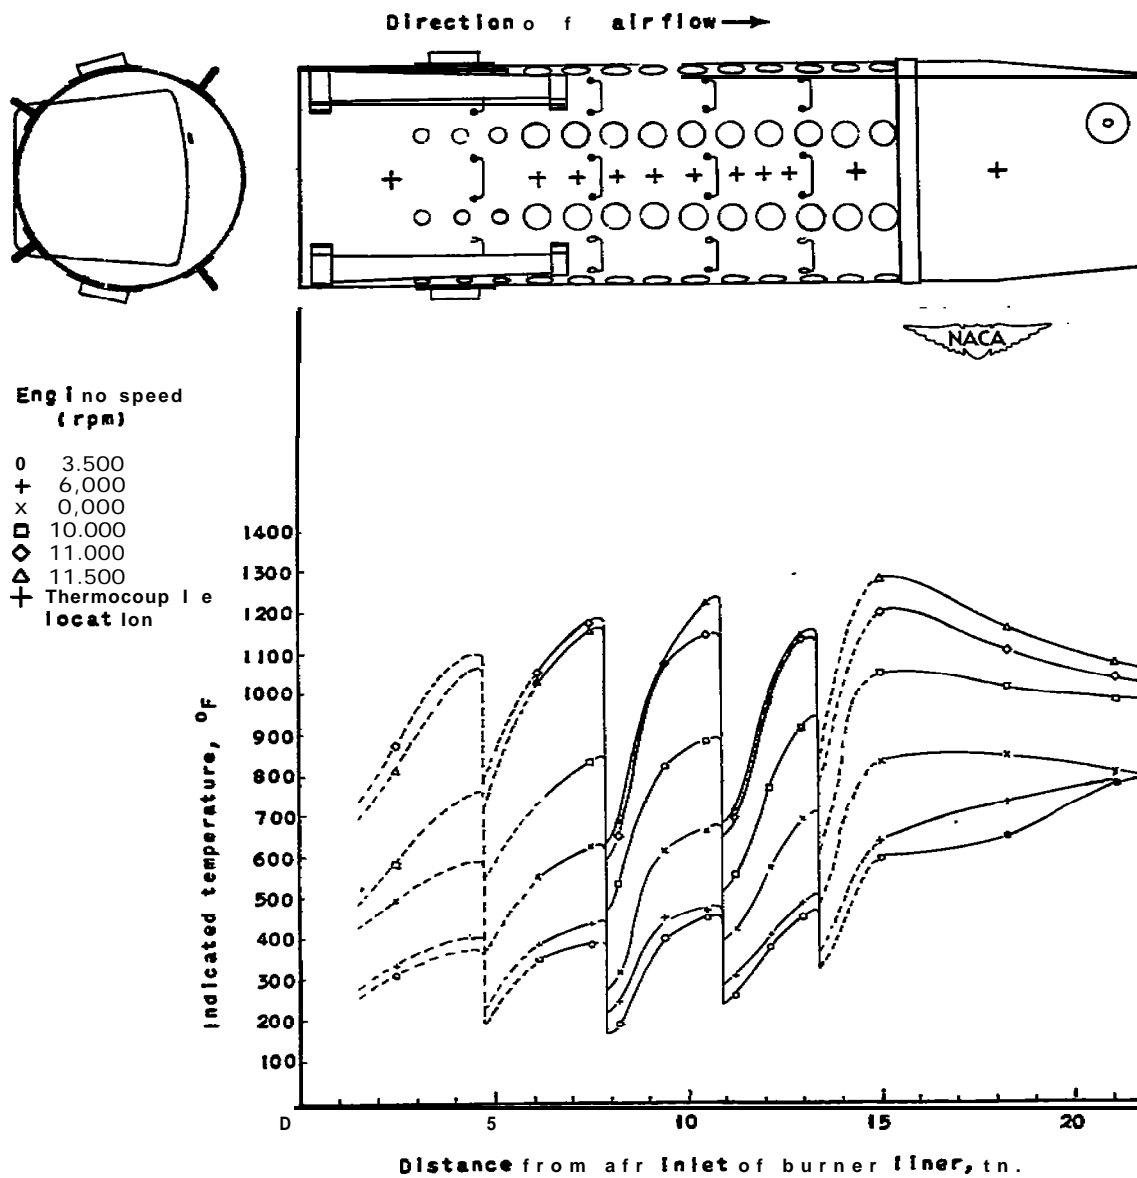


Figure 7. - Temperature variation along top row of cooling louvers on burner liner A at various engine speeds,

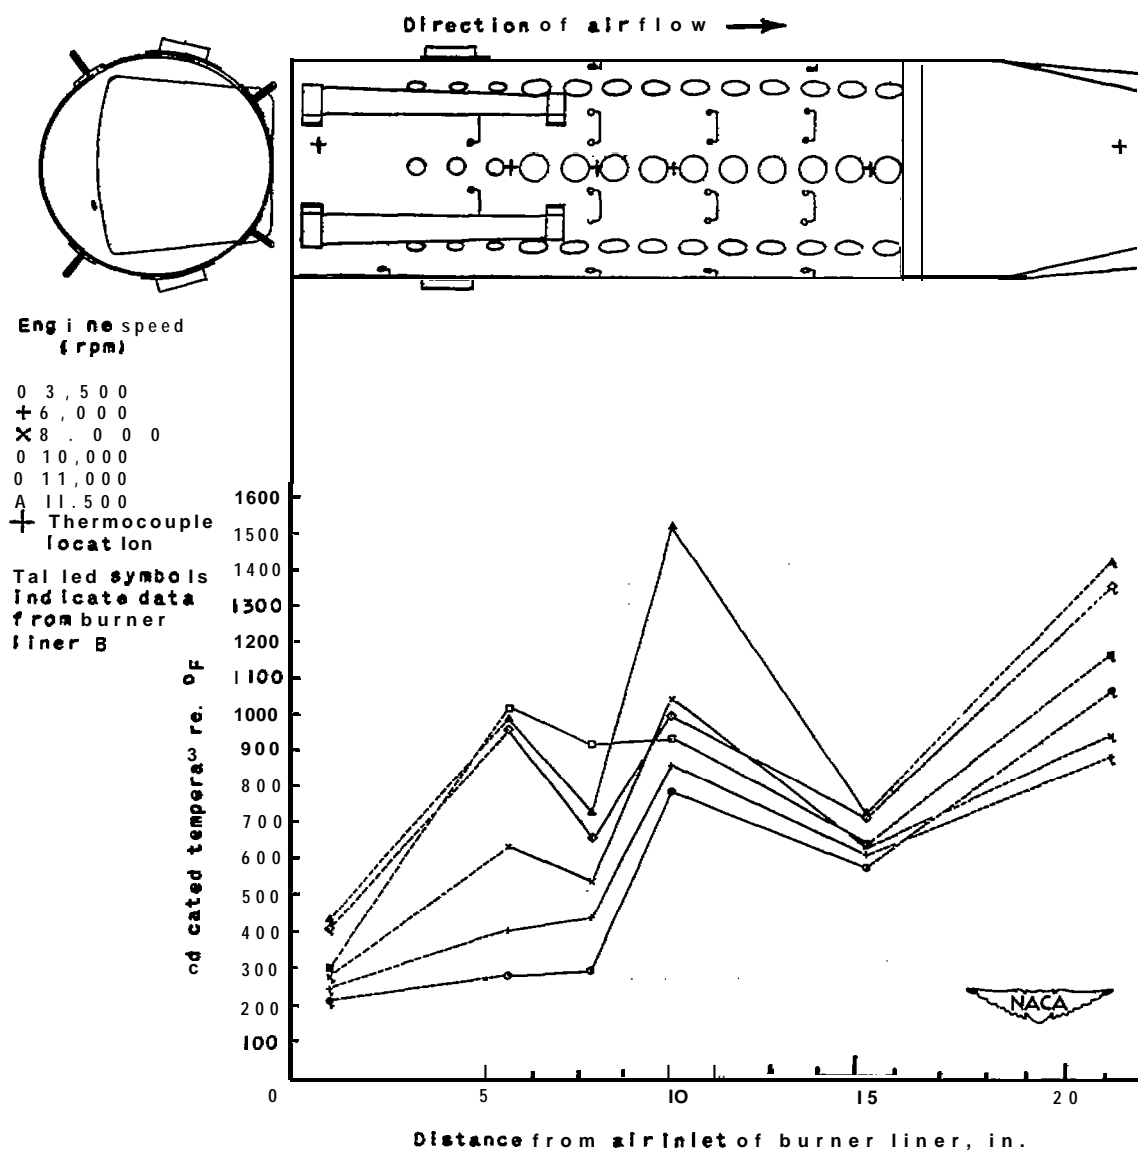


Figure 8. - Temperature variation along bottom row of air intake holes on burner liner A at various engine speeds.

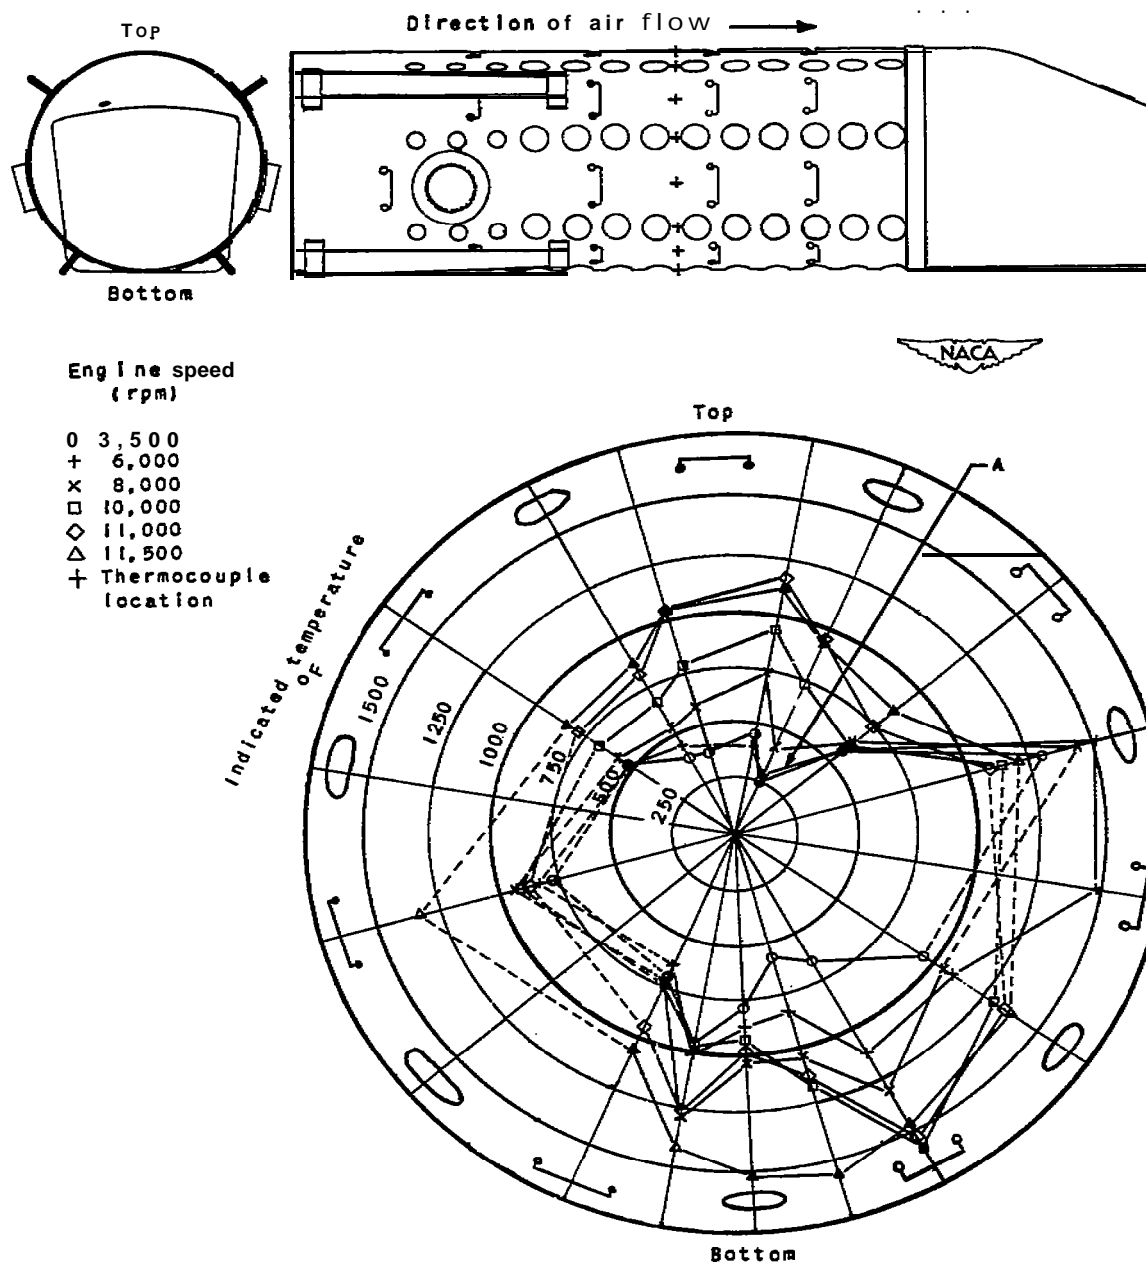


Figure 9. - Circumferential burner-liner temperature distribution near hottest temperature belt on burner liner A at various engine speeds. Average diameter of liner, 5.5 inches. [Dashed lines indicate missing temperature readings as a result of thermocouple failure.]

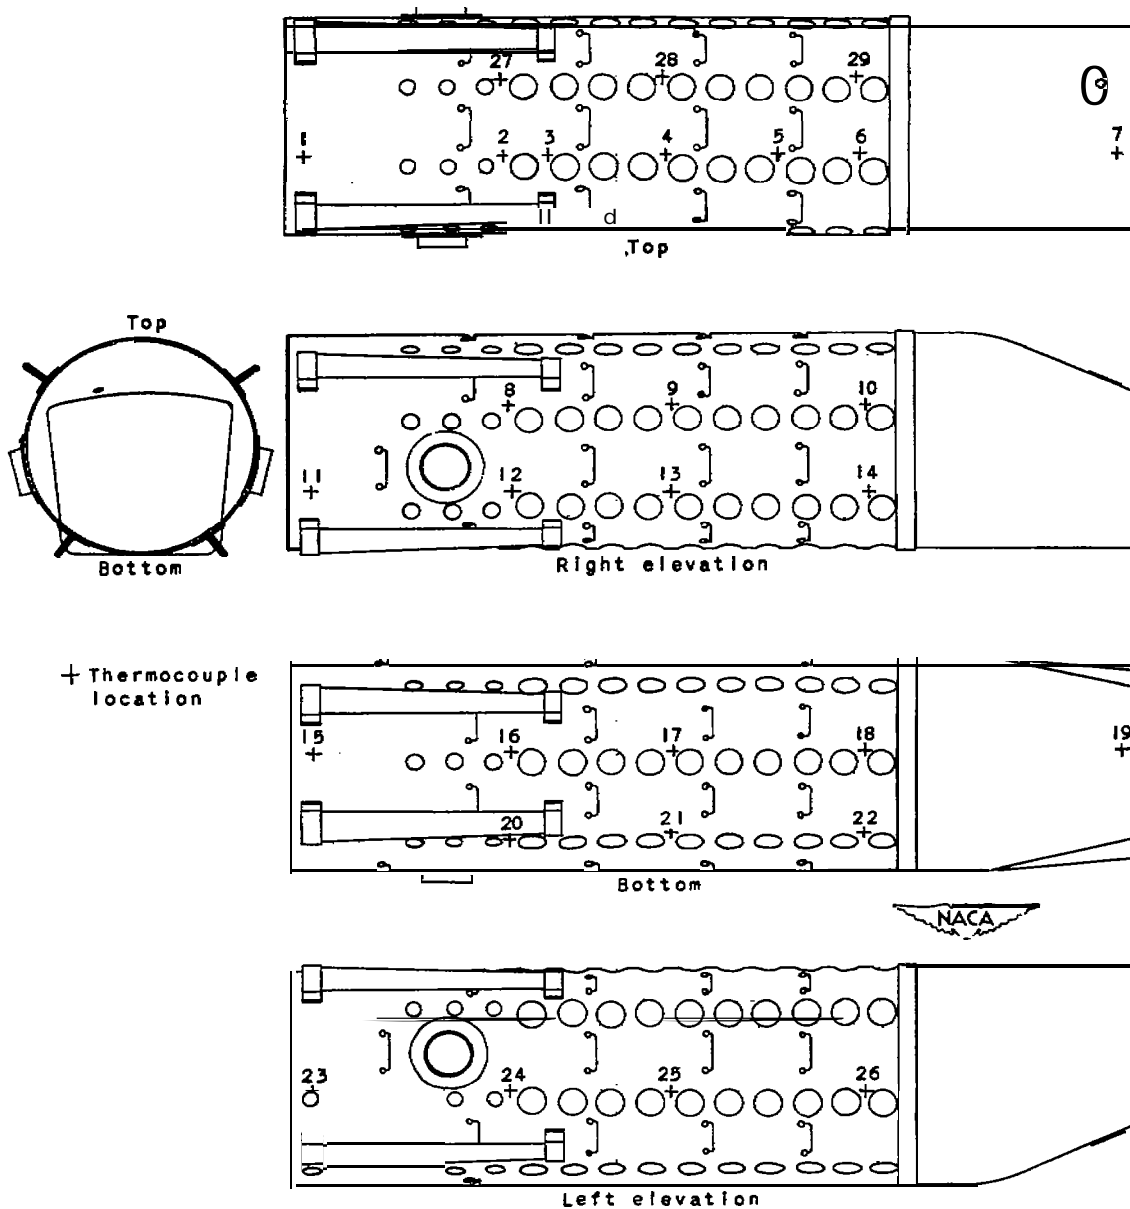


Figure 10. - Thermocouple locations and numbers on burner liner B.

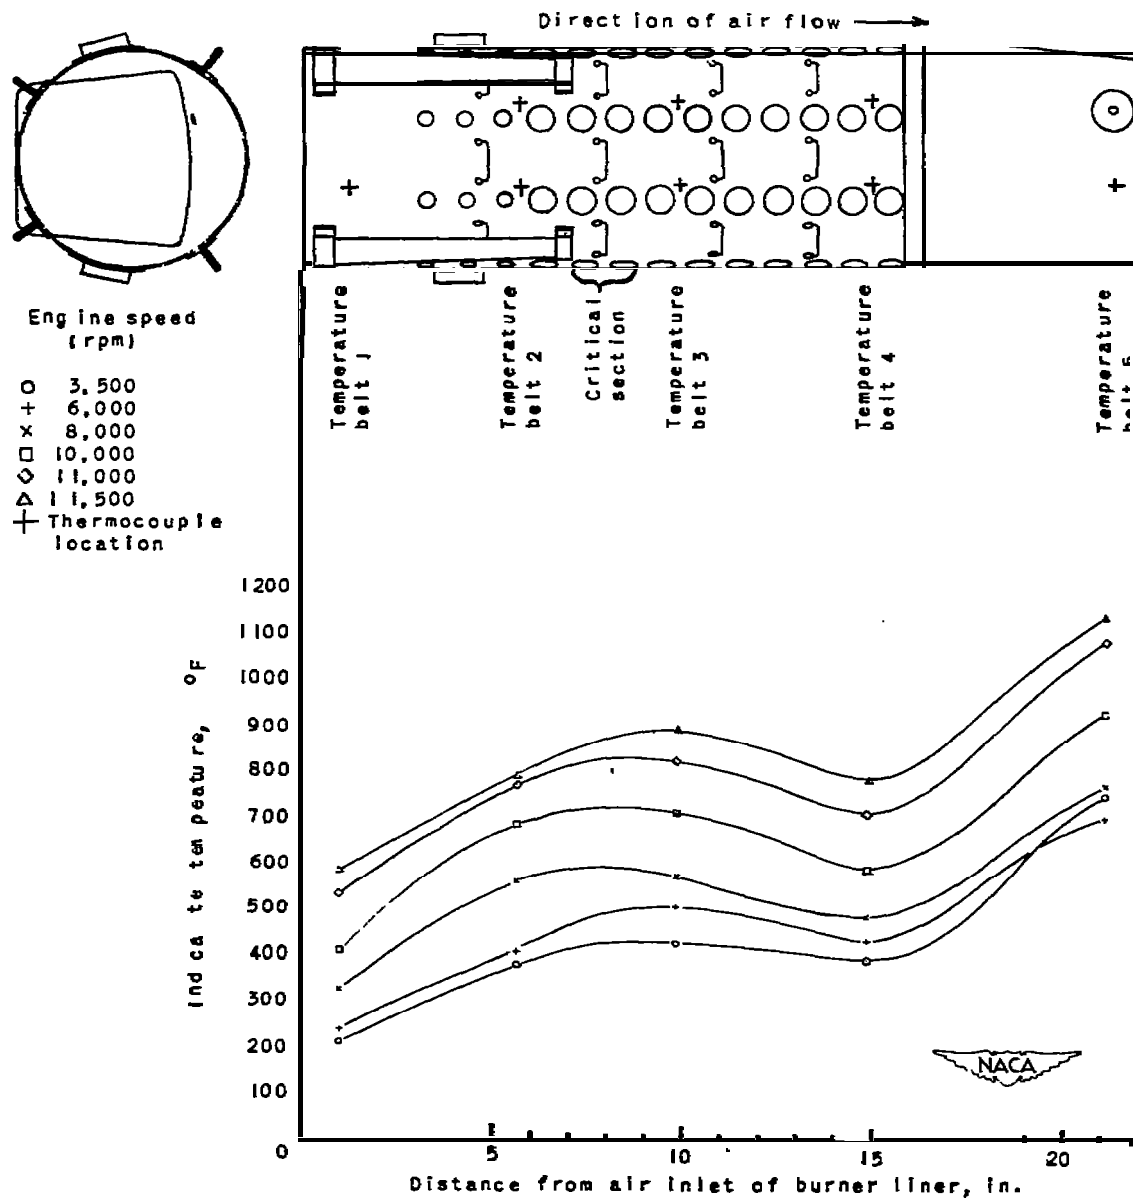


Figure 11. - Temperature variation along length of burner liner B. All points are average of belt temperatures.

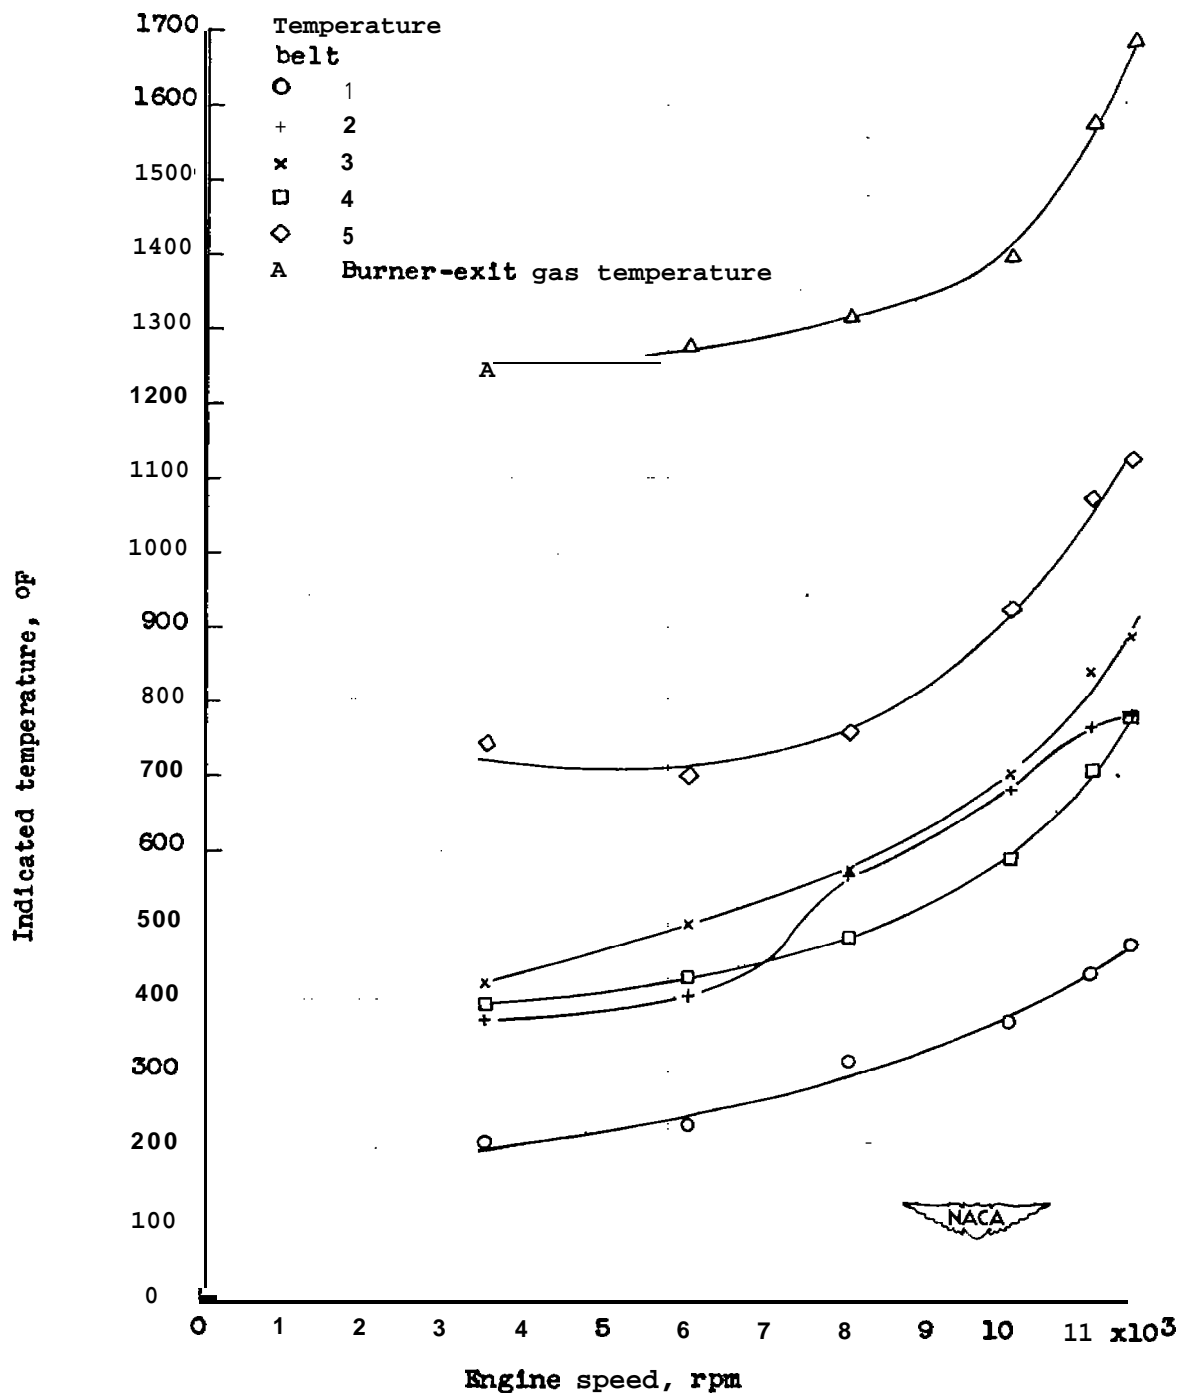


Figure 12.- Temperature variation with engine speed of temperature belts on burner liner B. All points are average belt temperatures. (See fig. 11 for belt location.)

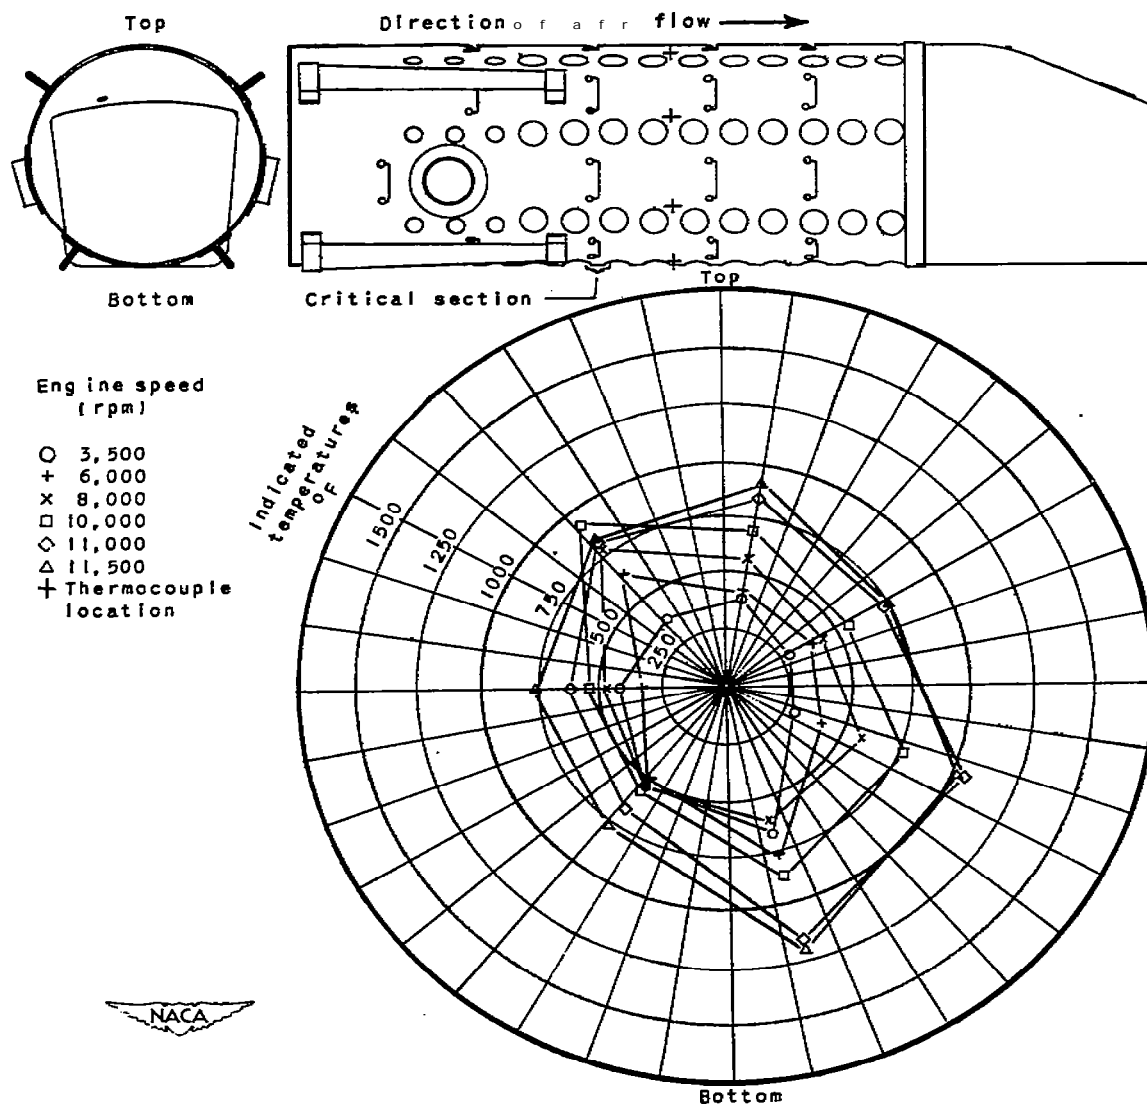


Figure 13. - Circumferential temperature distribution near-critical section of burner liner B at various engine speeds.

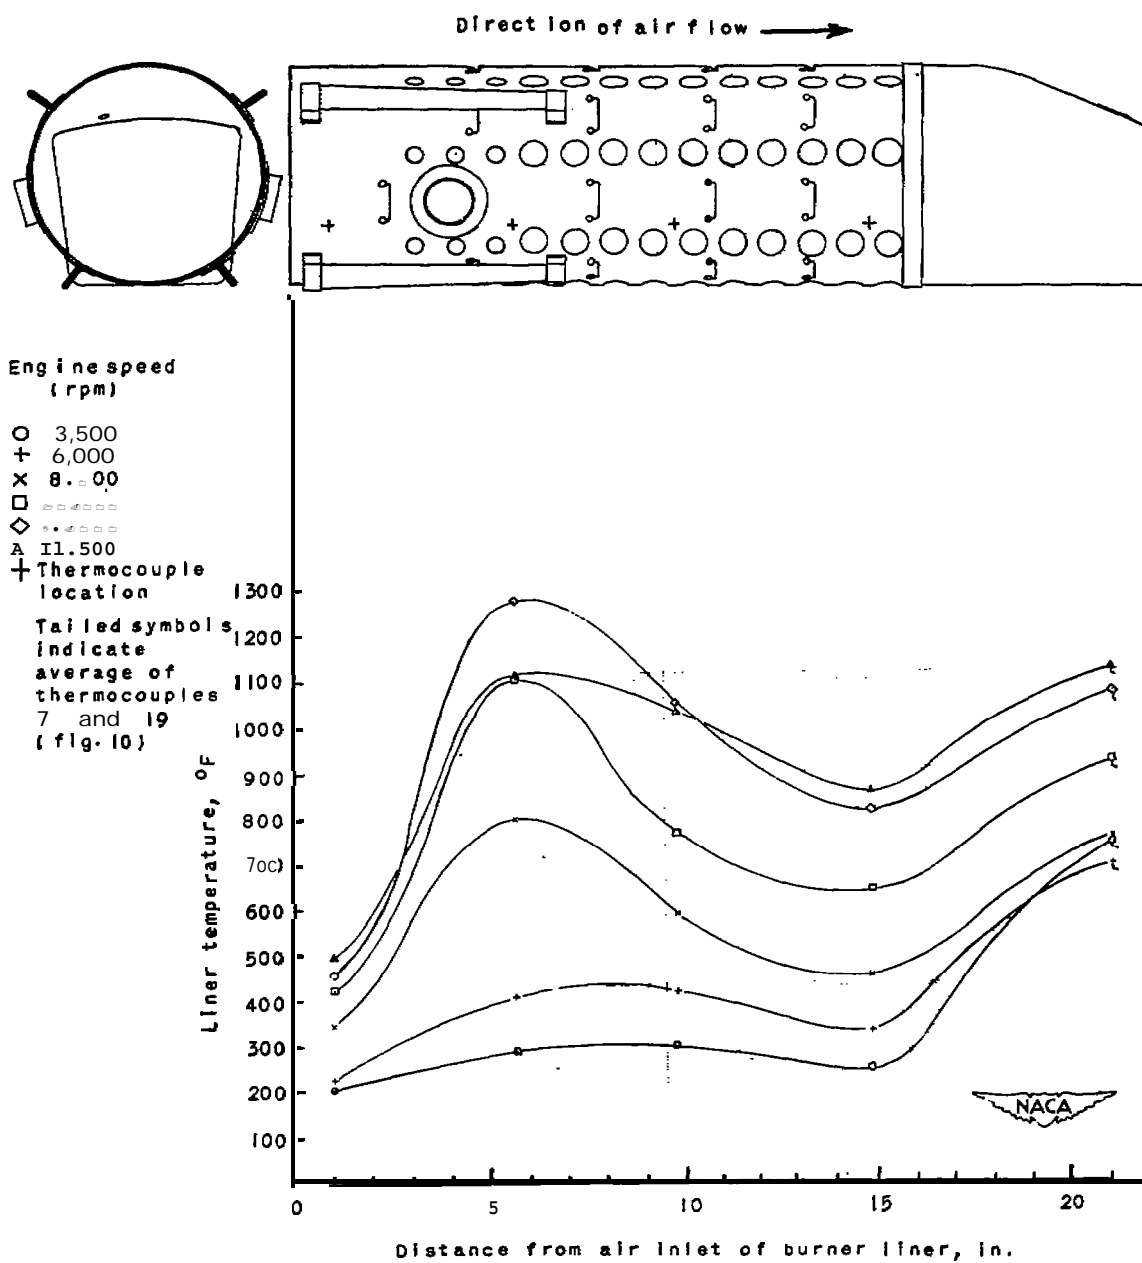


Figure 14. - Temperature variation along right side of burner liner B at various engine speeds.

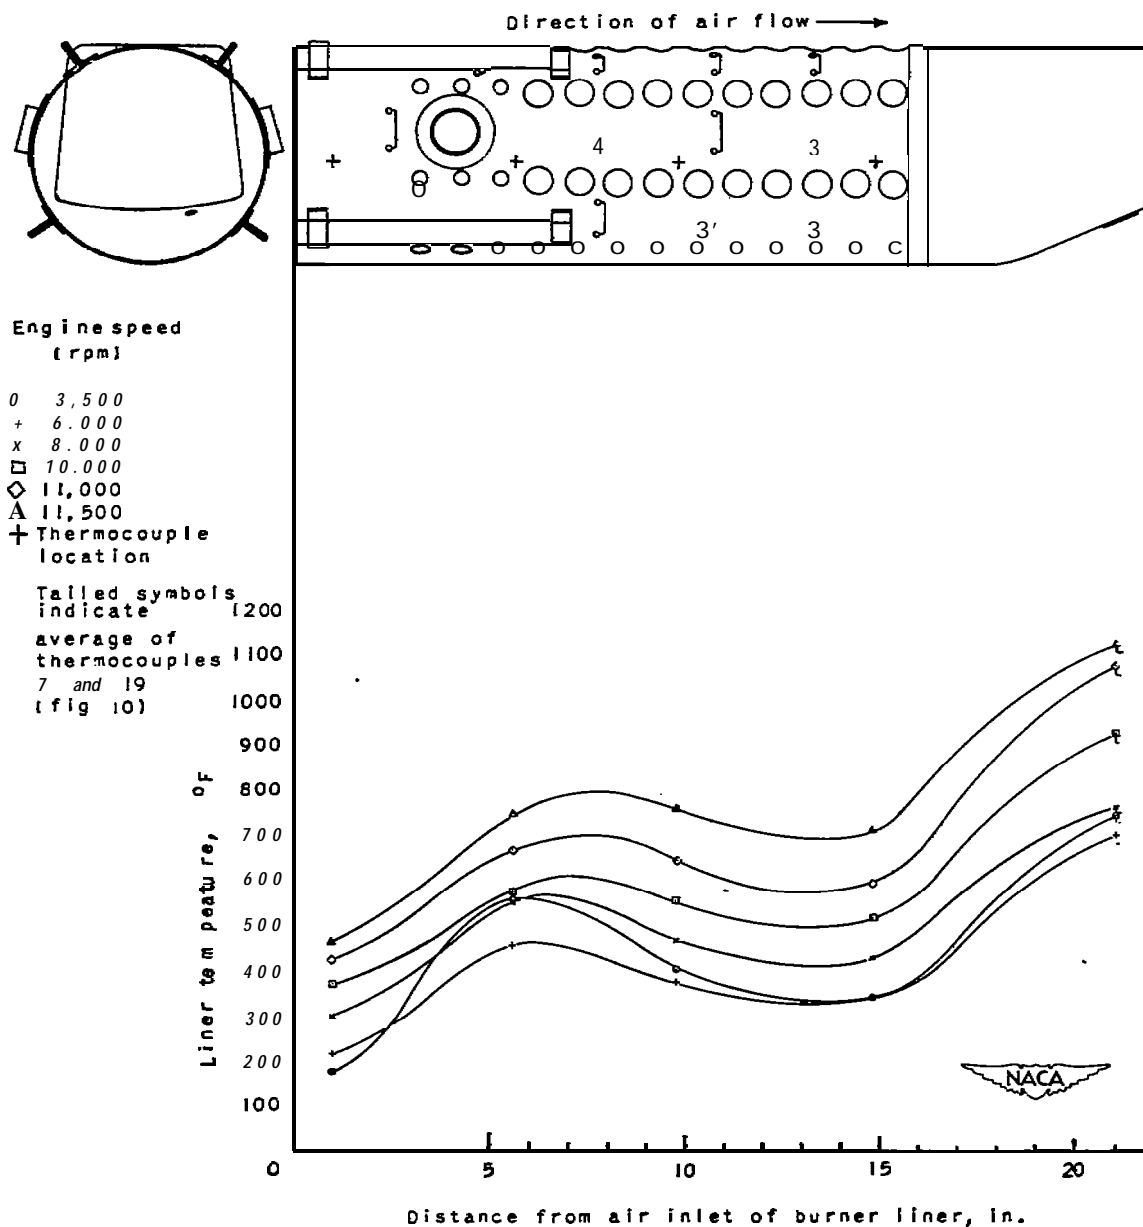


Figure 15. - Temperature variation along left side of burner liner B at various engine speeds.

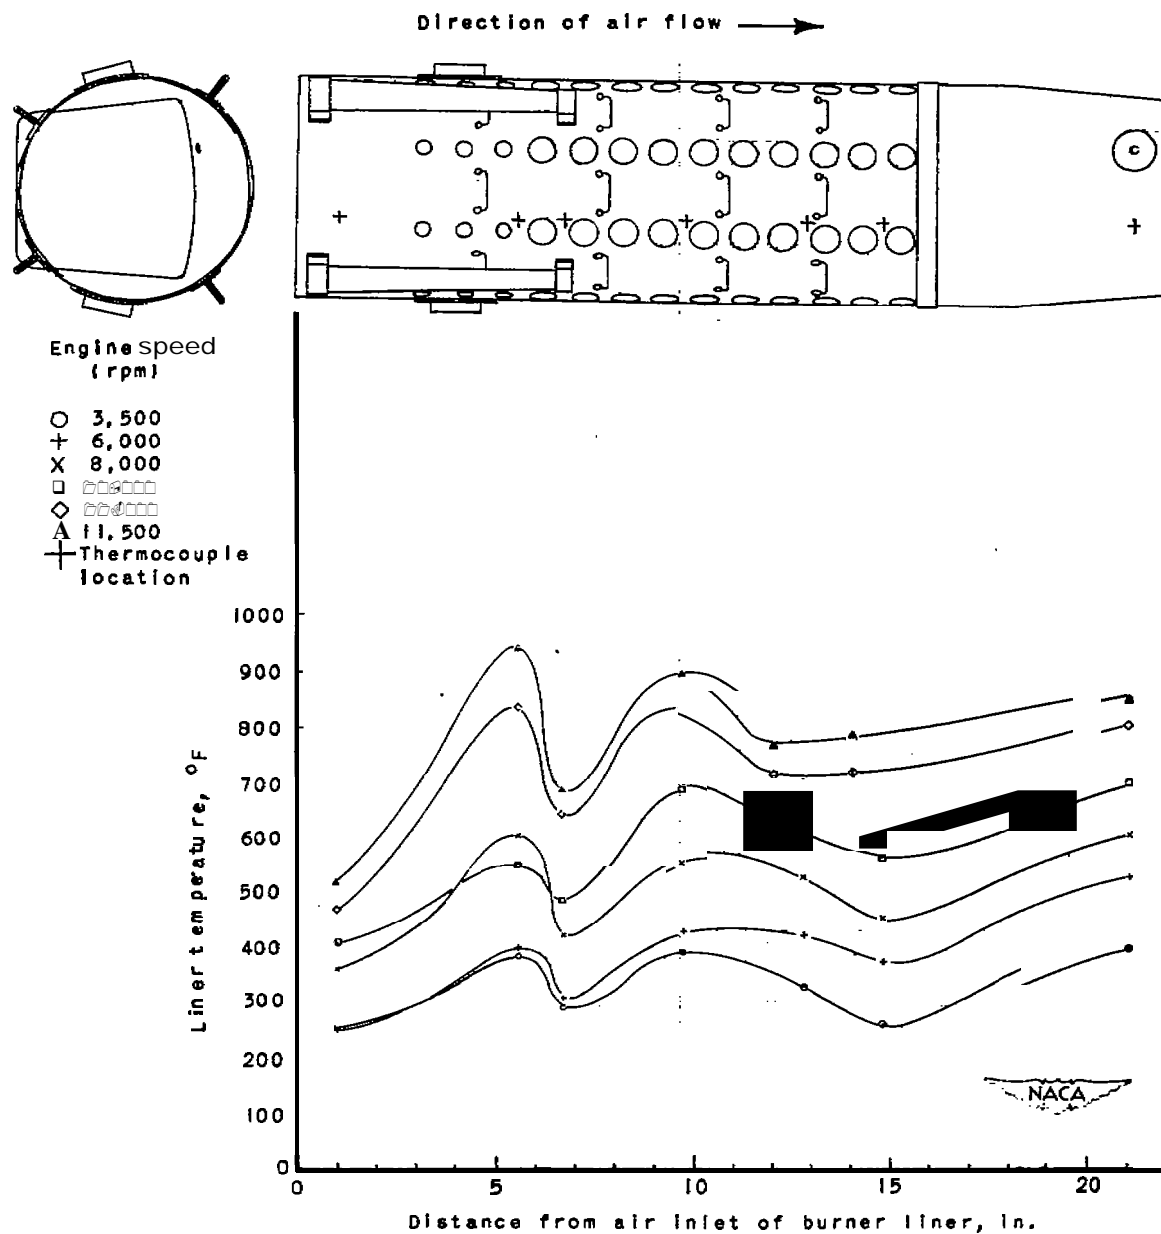


Figure 16. - Temperature variation along top of burner liner B at various engine speeds.

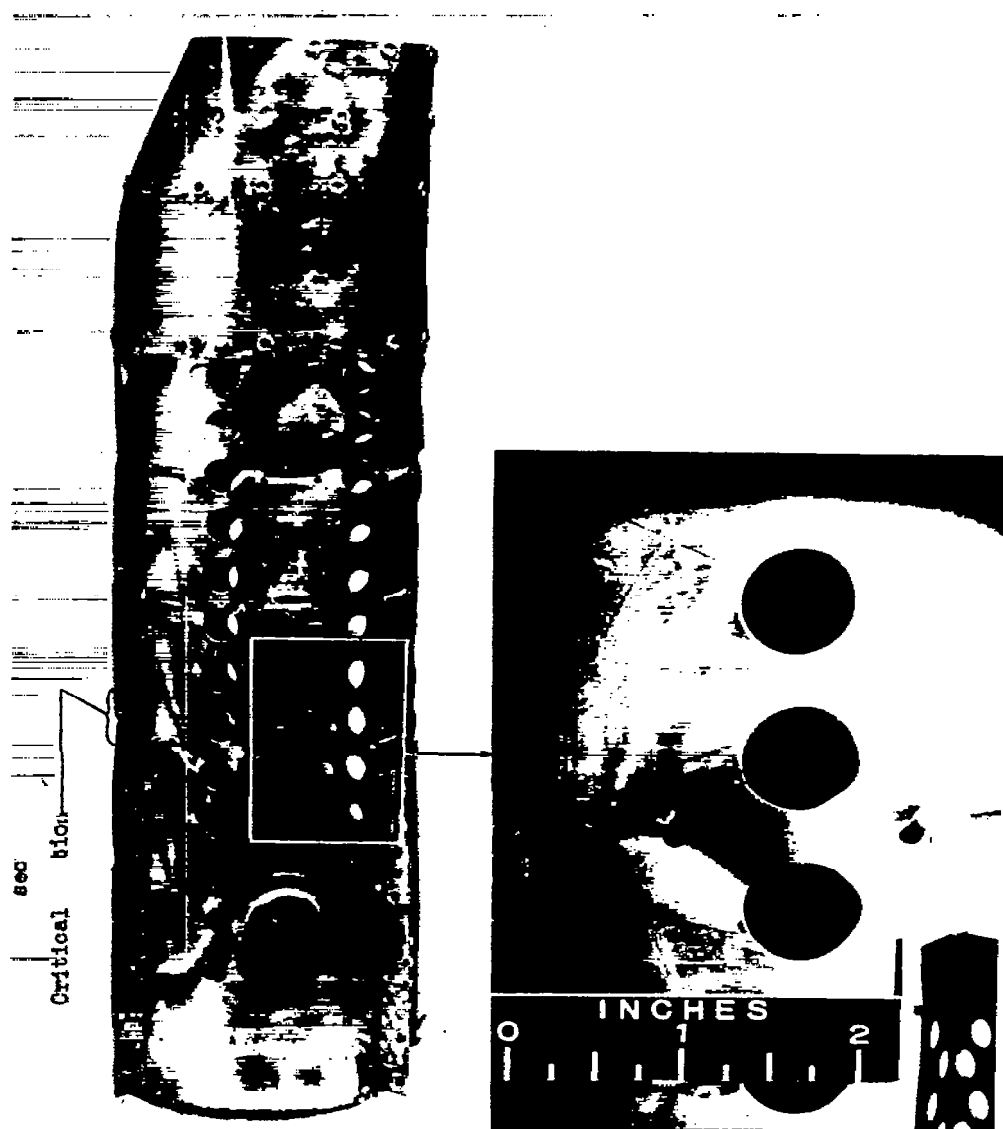


Figure 17. — Typical burner-liner failure. Total operating time, 36 hours and 10 minutes.

NASA Technical Library



3 1176 01435 5433